

# Release Notes - TC55 KK - BSP v02.52.02(nGMS)/v2.52.02G.07(GMS) - Stagefright Security Vulnerability in Android Devices - SPR 28147

---

[Introduction](#)

[Description](#)

[Contents](#)

[Device Compatibility](#)

[Installation Requirements](#)

[Installation Instructions](#)

[Part Number and Release Date](#)

---

## Introduction

SPR28147 - Security vulnerabilities have been identified in the Android Stagefright multimedia libraries.

Patch to fix SPR28147 is being provided for TC55- KK (GMS and non GMS) devices.

## Description

Vulnerabilities were discovered in the Android Stagefright multimedia libraries.

The patch addresses the following:

CVE-2015-1538  
CVE-2015-1539  
CVE-2015-3824  
CVE-2015-3826  
CVE-2015-3827  
CVE-2015-3828  
CVE-2015-3829  
CVE-2015-3864

## Contents

SPR28147\_TC55\_KK\_xx\_en\_025202\_v2.zip (TC55 KK Stagefright recovery update patch- applicable for both GMS & non GMS devices)

SPR28147\_TC55KKxxen025202\_v2.apf (TC55 KK Stagefright patch AirBEAM package - applicable for both GMS & non GMS devices)

## Device Compatibility

This software release has been approved for use with the following Zebra devices,

| Device | Operating System | OEM Version                   |
|--------|------------------|-------------------------------|
| TC55   | Android KK 4.4.3 | v02.52.02/v02.52.04 (Non-GMS) |
| TC55   | Android KK 4.4.3 | v02.52.02G.07 (GMS)           |

## Installation Requirements

This SW is intended for the TC55 KK device running non-GMS/GMS; 150422-SI-1800EN-02.52.02-23257-4.4.3-user / 150514-SI-1800EN-02.52.04-23257-4.4.3-user /150611-SI-1800EN-02.52.02G.07-23257-4.4.3 builds only.

## Installation Instructions

### For NORMAL installation of the PATCH:

1. Connect the USB cable from your PC to the device and enable USB mass storage mode on the device.
2. On your PC you should see an internal and external USB mass storage drive (SD card) appears in the File Explorer and copy the "SPR28147\_TC55\_KK\_xx\_en\_025202\_v2.zip" file to any storage.
3. Press and hold on the device the Power button, Scan/Action button and Vol+ button until the screen is turned OFF.
4. Release the Power and Scan/Action buttons and continue to hold Vol+ button.
5. The device should enter to Recovery update mode.
6. Release Vol+.
7. Click on Vol+ or Vol- to navigate and select appropriated storage.
8. Click on Scan/Action button to select the option.
9. Click on Vol+ or Vol- to navigate to the SPR28147\_TC55\_KK\_xx\_en\_025202\_v2.zip file.
10. Click Scan/Action button to select the recovery update zip file.
11. After update, reboot the device.
12. To verify that the patch is installed, you can check for the existence of the "SPR28147\_TC55\_KK\_xx\_en\_025202\_v2.txt" in /system/patch/. This '.txt' file will contain the SPR#s that are part of the patch and the patch build date.

SPR28147\_TC55\_KK\_xx\_en\_025202\_v2.txt file contents:

8-18-2015

SPR28147

### For MSP (REMOTE) installation of the PATCH:

Please refer Mobility Service Platform deployment guide for instructions.

## Part Number and Release Date

August, 2015